




Данную детализировку для вас
предоставила компания **Крунг**

10

Gauge list

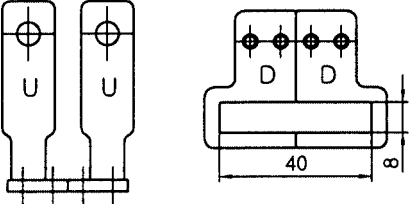
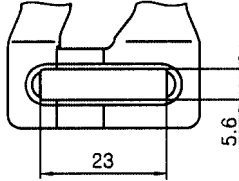
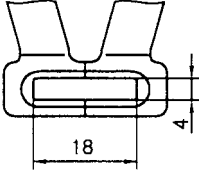
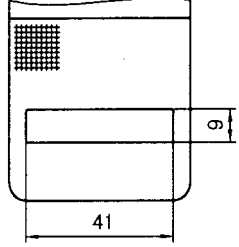
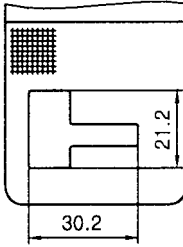
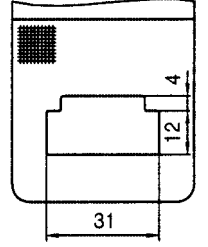
No	Name	SPS/A-B1201□			
		H(Heavy materials)	M(Medium materials)	L(Light materials)	K(Knitted materials)
1	Thread take-up lever (ass' y) 	▽ 08S001P-306H		△ 08S001S-306H	
2	Link cam 	02-002A-120H		△ 02S002S-306H	
3	Thread guide of needle bar 	04-007A-120H	04-008A-120M		
4	Needle 	DP × 17 #19	DP × 5 #16 (DP × 5 #14)	DP × 5 #11	
5	Shuttle race ring 	07-021A-120H	07-022A-120H	07-023A-120L	
6	Shuttle 	07-028A-120H	07-029A-120M		
7	Shuttle upper spring 	07S040S-306G ◇		07-041G-120L 07-040G-120L	
8	Thread tension control device 	○ 40S001S-306H	◇ 40S001S-306G		
9	Needle plate cover 	10-041A-120H	10-042A-120M	10-043A-120K	
10	Trimming lever-B 	◇ 10S055S-306G			
11	Lifting lever spring 	22-016G-120H	22-016G120M		
12	Presser foot (left) 	22-019A-120H	22-021A-120M	22-023A-120L	22-023A-120K
13	Presser foot (right) 	22-019A-120H	22-022A-120M	22-024A-120L	22-123A-120K
					22-024A-120K
14	Feeding plate 	22-029A-120H	22-030A-120M	22-033A-120L	22-035A-120K
				22-034A-120L (without knurling)	22-135A-120K (without knurling)

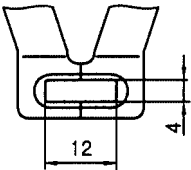
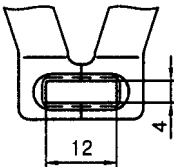
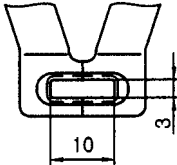
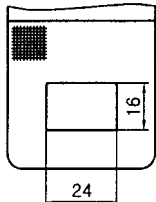
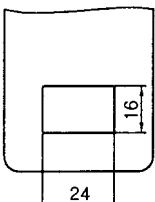
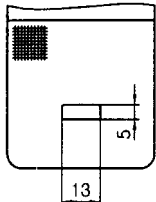
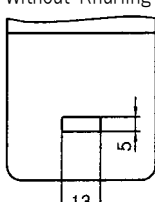
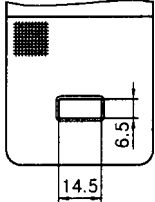
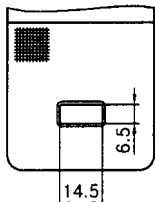
NOTE) ○ : Common use with SPS/A-1306H () types (Heavy materials)
 ◇ : Common use with SPS/A-1306G () types (Medium materials)
 △ : Common use with SPS/A-1306 () S types (Standard stitch)
 ▽ : Common use with SPS/A-1306 () P types (Perfect stitch)

11

Option list

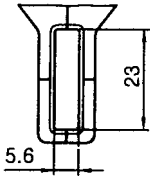
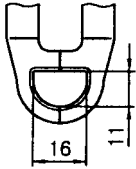
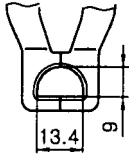
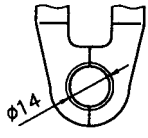
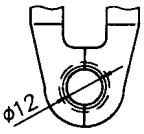
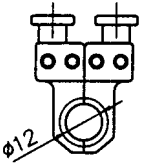
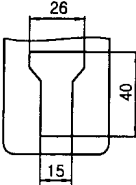
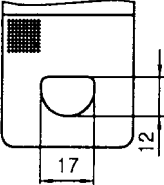
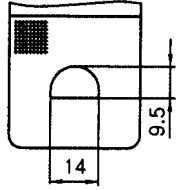
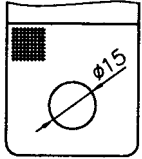
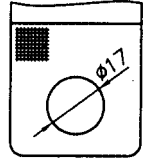
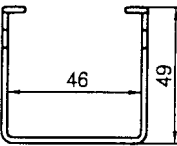
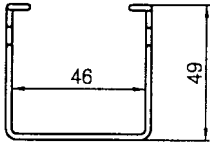
● Standard type

Name	SPS/A(B)-B1201 ☐		
	HA (Pneumatic pressure)	H (Heavy materials)	M (Medium materials)
Presser foot			
Ass'y	22-501A-120H	-	-
Left	U: 22-601A-120H D: 22-602A-120H	22-019A-120H	22-021A-120M
Right	U: 22-603A-120H D: 22-604A-120H	22-020A-120H	22-022A-120M
Feeding plate			
	22-143A-120H	22-029A-120H	22-030A-120M

Name	SPS/A(B)-B1201 ☐					
	L (For light materials)				K (For knitted materials)	
Presser foot					Without Knurling 	Without Knurling 
Left	22-023A-120L				22-023A-120K	22-123A-120K
Right	22-024A-120L				22-024A-120K	22-124A-120K
Feeding plate		Without Knurling 	t=0.8 	t=0.8 Without Knurling 		Without Knurling 
	22-033A-120L	22-034A-120L	22-035A-120L		22-035A-120K	22-135A-120K

● Option type

Name	Option-1	Option-2	Option-3	Option-4	Option-5	Option-5-1	Option-6
Presser foot							
Left	22-119A-120H	22-121A-120H	22-126A-120H	22-135A-120H	22-141A-120H	22-502A-120H (Ass'y)	22-144A-120H
Right	22-120A-120H	22-122A-120H	22-127A-120H	22-136A-120H	22-142A-120H		22-145A-120H
Feeding plate							
	22-129A-120H	22-130A-120H	22-128A-120H	22-030A-120M	22-143A-120H		22-147A-120H

Name	Option-Longwise	Option-Half-moon		Option-Circle		
Presser foot						
Left	22-123A-120L	22-131A-120H	22-231A-120H	22-138A-120H	22-238A-120H	22-539A-120H (Ass' y)
Right	22-124A-120L	22-132A-120H	22-232A-120H	22-139A-120H	22-239A-120H	
Feeding plate	Without Knurling 					
	22-133A-120L	22-134A-120H	22-234A-120H	22-140A-120H	22-240A-120H	
Finger guard		—	—			
	22-125A-120H	—	—	22-125A-120H		



По вопросам приобретения или с целью консультации
вы можете обращаться по телефону: (495) 989-22-97
или по e-mail: info@krung.ru

Также предлагаем вам посетить
наш информационный сайт
www.krung.ru